James Burtle

From:

jimc100@juno.com

Sent:

Thursday, October 07, 2004 2:45 PM

To:

James Burtle

Cc:

senator_mccain@mccain.senate.gov; Rick.Renzi@mail.house.gov

Subject:

Re: Your BPL Complaint

Mr Burtle:

Do the other 3 commissioners on this project also have trouble with their email?

As stated in my last email to you, as you well know, I DID complain to the system operator - months ago!

Here was the FCC STA grant: (FCC file #0506-EX-ST-2003FX) "Licensee should be aware that other stations may be licensed on these frequencies and if any interference occurs, the licensee of this authorization will be subject to immediate shut down." [What happened to immediate shut down? It doesn't state they have all the time in the world to 'fix' the interference]

Licensee Name: Electric Broadband File Number: 0136-EX-ST-2004 Call Sign: WB9XVP This authorization effective March 15, 2004 will expire 3:00 A.M. EST September 16, 2004 WB9XVP EXPERIMENTAL Purpose Of Operation: Establish a broadband on power lines trial. The PROGRESS REPORT should include, but is not limited to, a description of measurements and results demonstrating compliance with Part 15.109. [What happened to September 16, 2004?]

Note this is my PRIVATE complaint as licensee and taxpayer, over and above any others you have received.

Jim Clark N5RO n5ro@arrl.net

Dear BPL complainant,

The FCC has received your complaint of interference from a Broadband-over-Power Lines (BPL) to amateur radio. The Commission's policy is that parties who believe they are receiving interference from a BPL system should first refer their complaint to the system operator in order to give the operator an opportunity to remedy the problem.

You may have previously received an e-mail notice from me that the Commission has received your complaint. If so, please note that I am sending this message to several complainants because I recently discovered that I have had a problem with my e-mail software. Some of the messages that I sent were, in fact, not transmitted. I apologize if this message is the second e-mail that you have received acknowledging your complaint.

Jim Burtle

James Burtle

From:

kit [kit@ka0wuc.org]

Sent:

Thursday, October 07, 2004 4:06 PM

To:

Anh Wride; Alan Stillwell; Riley Hollingsworth; James Burtle; Sheryl Wilkerson

Cc: Subject: w1rfi@arrl.org BPL comments

cottonwood.pdf

(905 KB)

Attached is a PDF document containing a series of measurements from a BPL system in service near Cottonwood Arizona. The measurements were taken after "notching" was installed.

What is very noticeable is that even with efforts to minimize interference to the amateur radio bands, the signal levels from the BPL sites still impair HF operations.

In light of the numerous BPL sites that have shutdown operations due to interference, and countries that have rejected this technology, BPL is not a solution. At present this technology can not coexist with off air signals without conflict. Further research and development is needed if the BPL as it is today, should continue to operate.

Thru the Ethernet, past the Gateway, off the modem pool, nothing but NET . kitekaOwuc.org

Cottonwood Arizona, and BPL

During the weekend of September 25th, 2004 a road trip was taken to Cottonwood, Arizona. The destination is nationally known for the BPL (Broadband over Power Lines) test site by APS (Arizona Public Service) using equipment manufactured by Mitsubishi. Data was collected at the three sites in the Cottonwood area; Sawmill Cove, American Heritage Academy, and Birch Street. The purpose of the trip was to measure, and gain a better understanding of BPL technology. To understand the effects of BPL, test equipment was verified for calibration, and a method of measurement was established.

The plots show that the broadband carriers are no longer within most of the amateur radio bands. In a conversation with Mike Kinney, KU7W, they were moved days prior to my arrival. Mike Kinney is a part of a team of members that is closely monitoring the progress of the BPL testing in his area, his team has been gathering data and furnishing it to the ARRL on a frequent basis. Plots show an elevated noise floor from a broadband carrier, which on average consumed 5MHz of spectrum. One of the sites still showed activity in the 15-meter, 17-meter, and 30-meter bands. Audio was collected using an Icom R10 tuned to anywhere in the carrier, and sampled to a laptop to create a ".wav" file. The Icom R10 produced a tone in CW-N, LSB, or USB modes, an audio tone was heard while the receiver was tuned anywhere within the BPL carrier.

The configuration used for measuring the BPL sources closely emulated an HF mobile operation commonly used in the amateur radio bands. The data collected employed a 7foot whip antenna on the rear lift gate of a Jeep Cherokee. The antenna is part of the SGC (http://www.sgcworld.com) QMS-7 package. The package includes; a mounting kit, an externally mounted auto-tuner, and a 7-foot whip antenna. Functionality of the system was verified prior to testing the BPL sources within the amateur radio HF bands. To insure that the tuner wasn't altering the measurements, it was put into the "reset" condition. The "reset" condition removes all inductors and capacitors from the RF path, leaving the 7-foot whip antenna connected directly to the coax. This configuration allowed for a worse case tune of the antenna, which offered the most attenuation of the signal. A resonant antenna would present less loss of the frequency of interest. The noise floor was measured a quarter mile from the closest BPL test sites. The power source to run all the test equipment was a Hewlett Packard HP-85901A DC to AC voltage inverter. The HF whip antenna was connected to a Hewlett Packard HP-8951A RF spectrum analyzer with 6 feet of RG-213. Each BPL test site was sampled, looking closely at the HF portion of the spectrum. Data plots were then downloaded into a laptop with "Print Capture," software that communicates with the spectrum analyzer. The HF whip with tuner represented a system commonly used, but with degraded performance, as the tuner was not optimized for the frequencies under investigation. It was not practical to emulate a traditional HF base station, as the installation of a tower and beam antenna are difficult to setup for a temporary measurement. An HF mobile installation performs with less gain than a base station due to the size limitations of antennas used on a vehicle. versus those used on a tower.

Testing

Locations near the utility poles outfitted with BPL equipment were selected to take measurements. The three sites were visited and measured in a random order. No site had a priority or preference to another.

While at each location, the vehicle was parked within 10 meters slant distance of the utility pole's coupling point between the BPL equipment and the medium voltage lines. These are seen in the photographs as large red insulators. Distance was measured using a Bushnell Range Finder that was configured to display distance measurements in meters.

The engine was turned off; the spectrum analyzer and power source were turned on. The power on self-test was allowed to complete on the spectrum analyzer prior to attaching it to the antenna. The spectrum analyzer had been running on a separate AC inverter while the vehicle was in transit, allowing the instrument to stay operational and stabilize. The spectrum analyzer was attached to the QMS-7 in lieu of the HF transceiver. The reset button on the tuner was pressed and held until the "tune" LED was extinguished.

Brief scanning of the HF spectrum was performed using the spectrum analyzer. Once a broadband carrier was found that was not readily identifiable, it was monitored with the Icom R-10 handheld receiver. If the distinctive tone and clicking pattern was heard, further analysis was performed with the spectrum analyzer. If a broadband carrier was found and did not have the characteristics of BPL, it was ignored.

Plots were taken with the antenna not tuned to any specific frequency; therefore the gain of the antenna is less than a resonant antenna. Plots of the various carriers were stored into the laptop via the HPIB (Hewlett Packard Instrument Bus, also known as GPIB or IEEE-488) interface from the spectrum analyzer to the laptop. Captured plots were tagged with a name and date/time stamp of creation.

Photographs were taken of the sites with an Olympus C-3040ZOOM digital camera. The photos were also date/time stamped when created, and later transferred to the laptop for inclusion of this report.

Conclusion

The distances on average from each BPL test site were within 10 meters for the measurements. Signals were observed, and very noticeable within a city block, approximately 200 meters, of any of the test sites. With the sensitivity of a typical HF receiver used in amateur radio communications (-121dBm), a BPL site could be heard as far away as a mile. The plots taken from this specific test are considerably lower readings due to the type of antenna used for the sampling of data.

BPL is not shielded or containing the RF generated by the electronics used to transfer the broadband data on power lines. When comparing BPL to CATV (cable TV) one must remember that CATV is shielded which offers containment of the RF. The shielding of CATV is the fundamental reason why it can coexist with off-air services. BPL on the other hand is not shielded and not contained. It is this lack of containment with BPL RF that prevents it from coexisting with off-air services.


BPL, if allowed to continue operation in the United States would seriously hamper HF communications, if not disable it completely. HF is used not only by amateur radio operators for pleasure, but also in times of emergencies or natural disasters when other methods of communications fail. HF spectrum is an asset to the nation when used by amateur radio operators without the impairment of BPL.

Kit Haskins KAØWUC

PG-GB-013355

Testing configuration and inventory

The scale on the spectrum analyzer is logarithmic; each division is ten fold greater than the one below. The scale is referenced to 1 mW (1*10⁻³ watts into a 50Ω load) where 1 mW is 0 dBm.

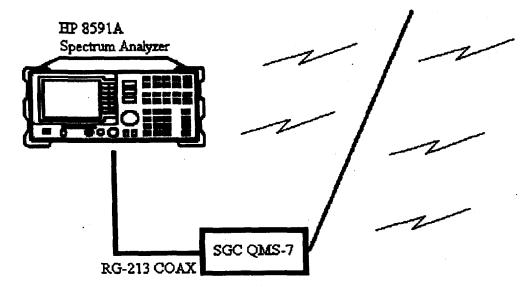

(Figure 1. Test setup)

Above is a block diagram showing the test configuration used for measuring the BPL signals. The QMS-7 with the 7-foot whip antenna was mounted on the lift gate of a 1996 Jeep Cherokee. The RG-213 was attached to the spectrum analyzer with a SO-239 to N male adaptor, as the instrument has an N female jack on the front.

Ne dige		1.205.4014	
Hewlett Packard	HP 8591A	RF Spectrum Analyzer 9 kHz to 1.8 GHz	Jun-05
Hewlett Packard	HP 85901A	DC to AC power source Portable ac power source	N/A
Icom	ICR-10	General Coverage Handheld Receiver 500 kHz to 1.3 GHz (cell blocked)	Self Cal
SGC	QMS-7	Mobile HF whip antenna	N/A
Bushnell ⁻	Yardage Pro 1000	Laser range finder	New Jan-04
Dell	Latitude XPi	Laptop with software to record audio and spectrum analyzer traces	N/A
Olympus	C-3040ZOOM	Digital camera	N/A
Jeep	Cherokee	1996 Jeep Cherokee	N/A

(Table 2. Equipment Used)

Data conversion

A typical receiver used in amateur radio has a loosely calibrated "S-Meter" used to indicate the signal strength of the incoming signal. The meter is simply a voltmeter also in a logarithmic scale. Each division on an "S-Meter" indicates an increase of 6dB of voltage on the receiver. The ARRL handbook refers to an old standard of S9 calibrated at 50 microvolts RF input and 6 dB per S unit down from that reference point. The S unit is what most amateur radio operators are familiar with when evaluating the received signal. The dBm scale is familiar to those in engineering practices.

Using the dB scale to measure gain or loss: $dB = 10 \cdot \log(out/in)$ some substitutions are used to reference this towards the 1mW level:

in = 1mW out =
$$\binom{V^2}{R}$$

V = volts (1 μ V would be 0.000001V)

 $R = impedance (usually 50\Omega)$

With the elements substituted the whole equation from microvolts to dBm is derived:

$$dBm = 10 * \log \left(\frac{V^2}{50\Omega} \right)$$

(Equation 1. dBm from Volts)

Rearranging the formula to solve for the microvolts from dBm. Converting from dBm to microvolts will ultimately get the S units from the plots of the spectrum analyzer:

$$V \approx \sqrt{R * 1mW * 10}^{(dBm/10)}$$
(Equation 2. Volts from dBm)

Converting from dBm to dB μ V simply take the dBm value and add 107:

 $0dBm = 107 dB\mu V$ (Equation 3. dBm to dB μV) S-9 is $50\mu V$ into a 50Ω load; using equation 1, S-9 would correlate to -73 dBm.

		. 370		no readount
· S1	-121	-151	-14	0.2
S2	-115	-145	-8	0.39
S3	-109	-139	-2	0.78
S4	-103	-133	4	1.56
S5	-97	-127	10	3.13
S6	-91	-121	16	6.25
S 7	-85	-115	22	12.5
S8	-79	-109	28	25
S9	-73	-103	34	50
S9 + 10dE	-63	-93	44	158.3
S9 + 20dE	-53	-83	54	500.5
S9 + 30dE	-43	-73	64	1583

(Table 2. S Units)

Field Strength:

$$\frac{dB\mu V}{m} \approx dBm + 107 + AntennaFactor(@ frequency)$$

(Equation 4. $dB\mu V/m$ from frequency of operation and spectrum analyzer reading)

Bandwidth Conversion:


Bandwidth _Correction
$$\approx 10 * \log(\frac{new}{old})$$

(Equation 5. Converting bandwidth)

Example:
$$-5.22879 \approx 10 * \log(9 \frac{KHz}{30 \frac{KHz$$

When inspecting the plots, any point on the graph above -73dBm is a signal that is equal to or greater than S9 on a typical amateur radio HF receiver. The same point is at $34dB\mu V$ or greater.

Antenna Factor of QMS-7

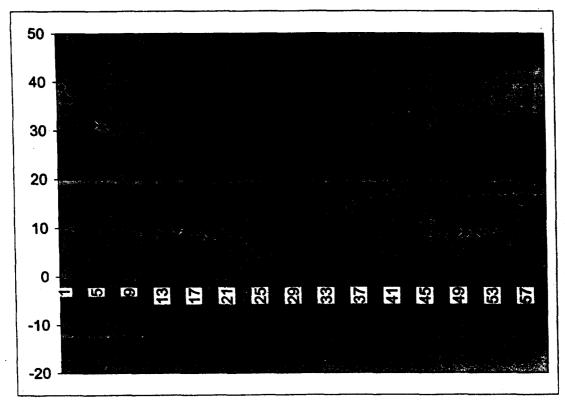

(Chart 1. QMS-7 Antenna Factor from 2MHz to 60MHz)

The chart above is a derivation of the QMS-7's performance when performing a relative measurement against the ETS-Lingren passive loop and biconical EMC antennas. The chart shows the Antenna Factor from a range of 2MHz to 60Mhz.

To determine the field strength of the measured signals on the spectrum analyzer, the frequency and amplitude must both be known. Looking on plot #3 from American Heritage Academy, it shows a point around 35MHz that is approximately -65dBm.

The field strength from that plot is determined to be:


 $52.3dB\mu V/m$

-65dBm + 107dB + 12.3dB (Antenna Factor at 35MHz) = $54.3dB\mu V/m$

e escolos espaciones -	Delicated	31	2.8
	39	32	16.6
<u>2</u> 3	36.3	33	17.5
4	38	34	12.4
	37.3	35	12.3
5 6 7	31.3	36	14.1
7	30.9	37	15
8	29.5 21.5	38	13.9
9	21.5	39	15.7
10	13	40	15.7 15.6
11	8.8	41	16.5
12	12.8	42	18.3
13	31.7	43	
14	27.6	44	17
15	15.6	45	
16	9.5	46	21.8
17	9.4	47	16.6
18	10.3	48	14.5
19	10.3 8.3	49	12.3
20	7.6	50	
21	8.2	51	9
22	-6.2	52	
23	-6.5	53	7.8
24	-3.9	54	
25	-3.2	55	
26	7.4	56	9.3
27	4	57	8.2 7
28	13.6	58	7
29	-2.7		6.8
30	-10.1		


(Table 3. Antenna Factor of QMS-7 by frequency)

Sawmill Cove

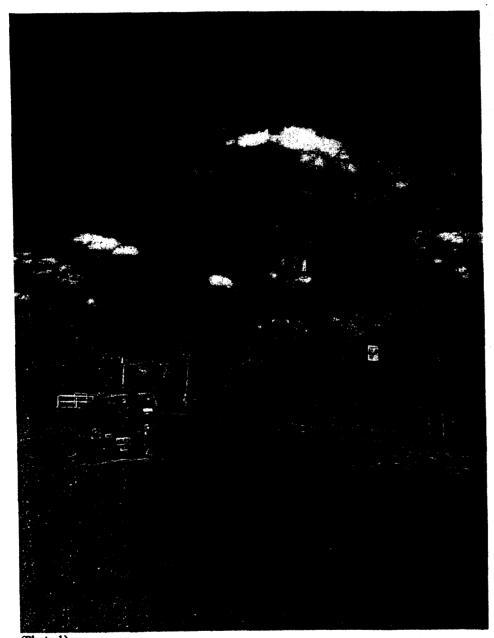


(Photo 1)


The utility pole on the near right shows a red insulator that couples a wire to the box further down at the 8-foot level. Measurements where taken along the side of the road, as shown in the photo. Signals were still present at or near the same amplitude along the span to the next utility pole. The medium voltage line appears to radiate the signal like a horizontal antenna. Horizontal polarity is the dominant polarity used in HF base station communications.

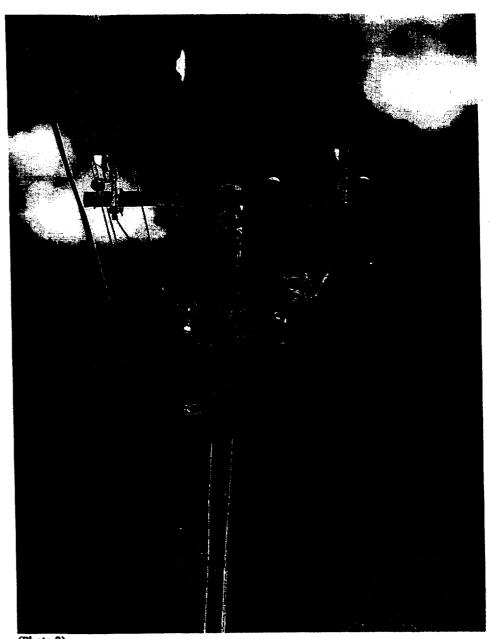

(Photo 2)
Closer photo of the BPL equipment mounted on the utility pole. The red insulator is a hint that BPL is present on this utility pole. A medium voltage line is run down the center of the pole, protected with PVC or other plastic material to the box which houses the electronics further down the pole. The BPL signal is not shielded with the PVC or plastic material, allowing it to radiate with vertical polarity. Vertical polarity is the dominant polarity used in mobile HF communications.

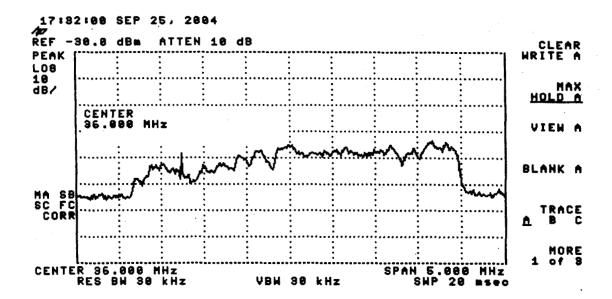


(Plot 1)
A sample of HF spectrum around 36Mhz, the width of the span is 5Mhz; each division is 0.5MHz. The range of the plot is from 33.5Mhz to 38.5Mhz, there are no HF amateur bands in this portion of the spectrum. The signal is on average S9+ on an HF receiver.

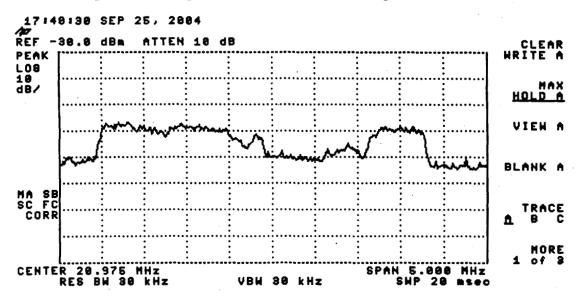


(Plot 2)
This plot shows a second set of carriers, 18Mhz and 22Mhz at -60dBm. The 4th vertical column from the far right is the amateur 15-meter band (21.100MHz to 21.450MHz). The signals represent S9+10dB on an HF receiver.


American Heritage Academy

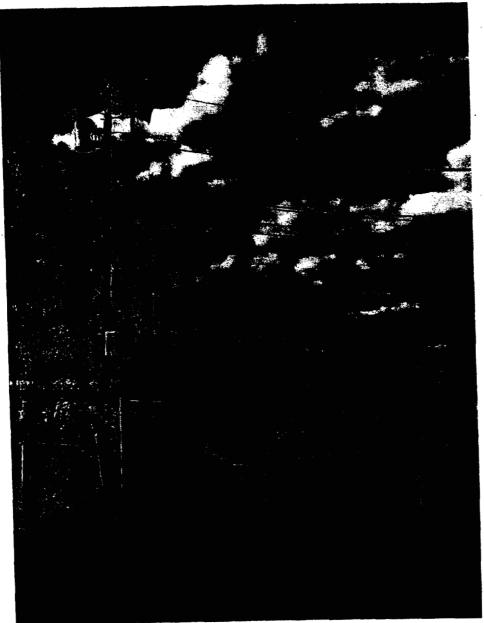


(Photo 3)
Notice the red insulator on the utility pole at the second test site. The box mounted at about 8-feet is the housing for the electronics of BPL. The vehicle was moved after the photo was taken, positioned here for a reference.

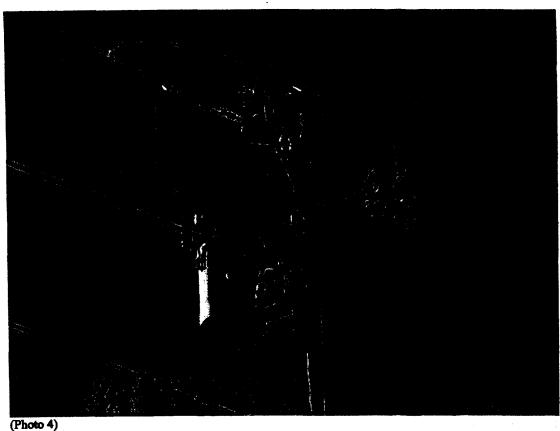


Close up detail of the BPL wiring that was added to the utility pole. The red insulator is attached to a wire that is run down to the electronics box at a lower level. The BPL signal is capable of radiating on the vertical and horizontal runs of wire.

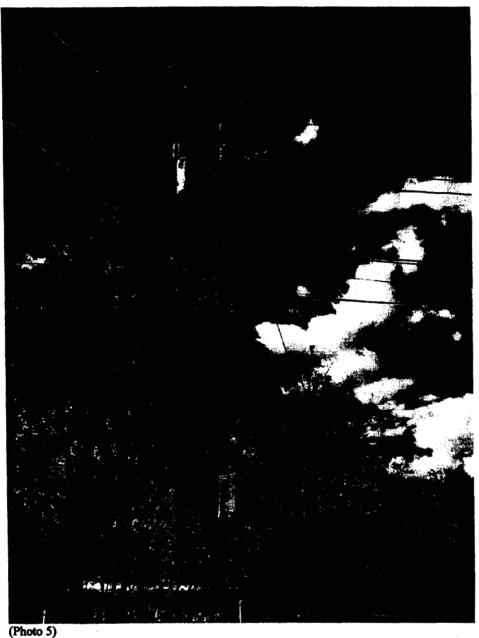


Shown is the box that houses the equipment, which is attached to the medium voltage lines further up on the utility pole. Note the PVC or other plastic material used to protect the medium voltage line that is run down the pole to the box with the electronics equipment.

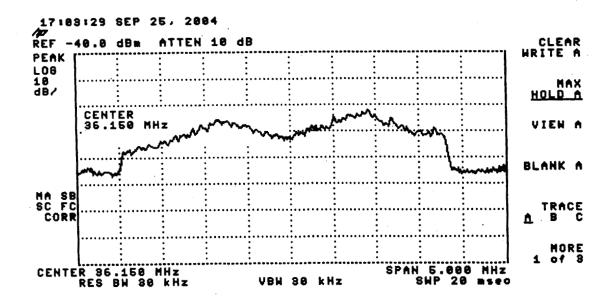


(Plot 3)
The signal looks like two broadband carriers positioned side-by-side in the spectrum.
These carriers are not within amateur radio allocation, but again sampled to learn the effects of BPL. When monitored with a HF receiver the signal strength would exceed S9+10dB.

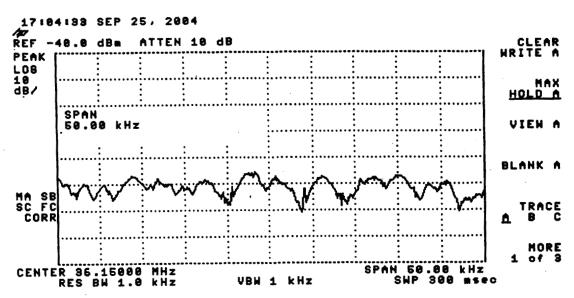


(Plot 4)
Span zoomed to show individual carriers randomly spaced near 5KHz from each other.
As the ICOM R-10 receiver was tuned anywhere between 34.150MHz and 37.900MHz a tone with a cyclic clicking was heard on the receiver in the following modes: CW-N, USB, and LSB.

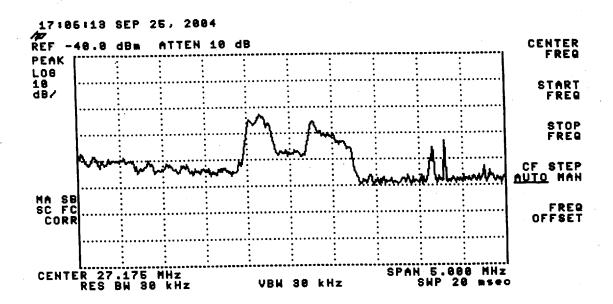

(Plot 5)
These carriers were also noticed, and are in the Citizens Band portion of the HF spectrum. While watching the site in a broader span, these carriers along with the carriers present at 36MHz came up and down together.

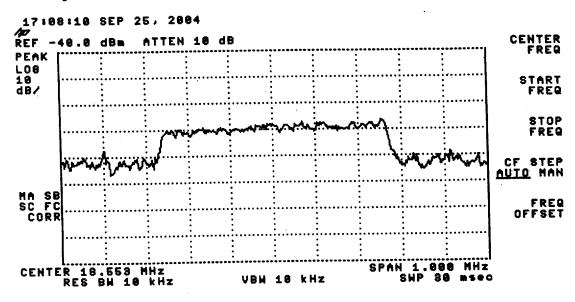


(Plot 6)
This carrier is centered on 18.55MHz, but with a bandwidth of 600KHz, it does approach the 17-meter band (18.068MHz to 18.168MHz) at a level equal to S9+ on an HF receiver.

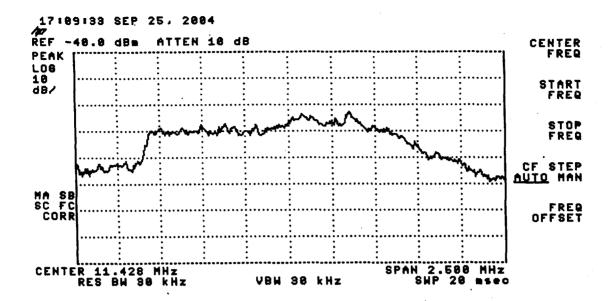


(Plot 7)
This carrier is also out of the amateur radio bands, but is close enough to interfere with 10MHz WWV reception. I was able to receive 10MHz WWV when this site was atleast ¼ mile away. As I approached this BPL test site, the noise floor captured the receiver. This carrier also hampers the ability for amateur radio operators to use the 30-meter band (10.100MHz to 10.150MHz) with a reading approaching S9+ on an HF receiver.


Birch Street

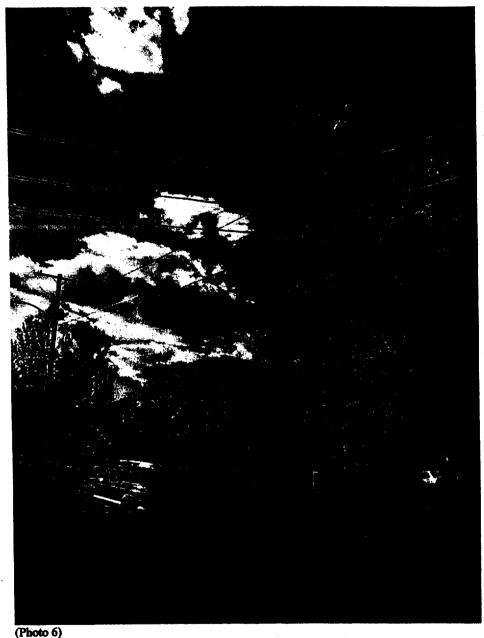


Birch Street shown with the equipment mounted on the pole on the right side of the photo. The Jeep was moved around this block and found uniform signal strength from the BPL equipment. The vehicle was positioned 10meters from the coupling point of the BPL equipment when the measurements were taken.

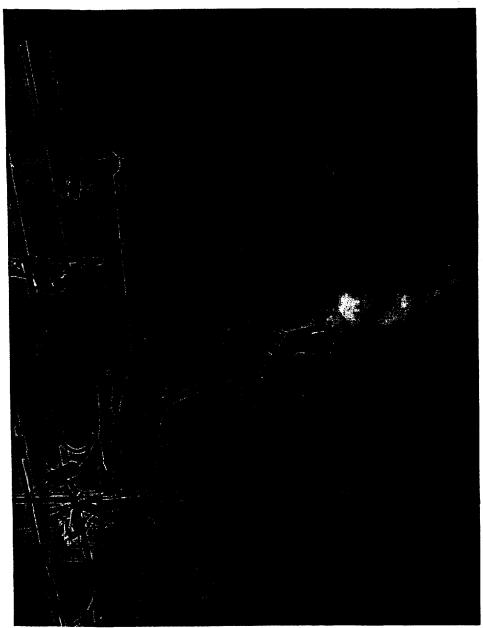

(Photo 7)
Birch Street BPL test site showing the red insulator and wire that is run from the medium voltage, down the pole, to a box that houses the electronics equipment used for BPL transmission.

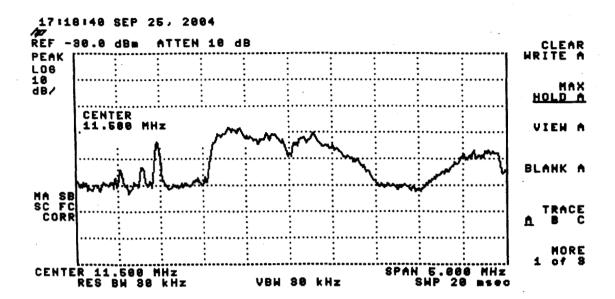

(Plot 8)
The carriers centered around 11.5MHz are strong enough to interfere with 30-meter (10.100MHz to 10.150MHz) operations. WWV on 10MHz was difficult to receive.

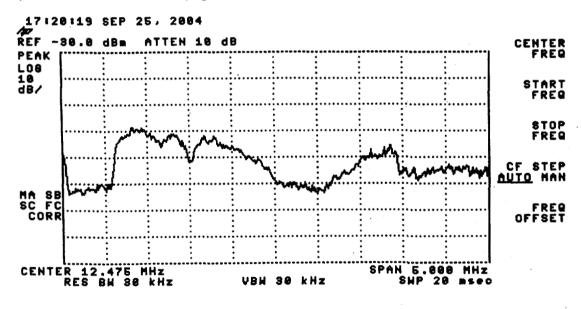

(Plot 9)
Additional carriers from the same BPL test site are present around 12.5MHz. This is strong enough to eliminate any ability to receive short wave broadcast services.

James Burtle

From:

jimc100@juno.com

Sent:

Saturday, September 25, 2004 8:03 AM

To:

James Burtle

Cc: Subject: w1rfi@arrl.org; xytek@commspeed.net RE: Harmful Interference Complaint

Mr. Burtle,

The interference complaint was submitted to the system operator, the consultant, and the so-called Internet provider, with not even a response, let alone any remedial action.

As you should know, the system operator has NOT been successful in notching out amateur frequencies, though they have moved the interference to other amateur frequencies. This does not qualify as notching out amateur frequencies. Your reasoning would require me to file a complaint every time they played this "shell game" and moved frequencies, until such time as the system is fully deployed, and then amateur radio would be totally useless and it would be impossible to put the genie back in the bottle.

It is my belief that the FCC should be enforcing Part 15 of the Communications Act in this instance, as you are doing with all other manner of even minor cases of interference, and it is my right to insist the FCC do so. It seems strange that these people are allowed to continue this "test" (actually a marketing ploy) on amateur frequencies while careful to protect military and other government frequencies. The system operator has had MONTHS to correct this - way beyond a reasonable time.

The FCC should also be concerned about the effect this has on homeland security, since many individual amateur radio operators, RACES (a government-sponsored program), ARES, etc. are committed to emergency communications - vital should other systems be compromised in an incident.

Thanks for the FCC's long overdue attention to this problem.

Jim Clark N5RO

n5ro@arrl.net

-- "James Burtle" <James.Burtle@fcc.gov> wrote: Mr. Clark,

We have received and noted your report. Please submit your interference complaint to the system operator first to give him/her an opportunity to fix the problem. BPL systems have been successful in notching frequency bands.

Thank you,,

Jim Burtle

*** Non-Public: For Internal Use Only ***

----Original Message----

From: jimc100@juno.com [mailto:jimc100@juno.com]

Sent: Friday, September 17, 2004 8:30 AM

To: Alan Stillwell; Anh Wride; James Burtle; Michael Powell; Riley Hollingsworth

Cc: xytek@commspeed.net

Subject: Harmful Interference Complaint

Why have I not received an acknowledgement of my harmful interference complaint noted below? Jim Clark N5RO n5ro@arrl.net

From: Jim Clark N5RO (email: jimcl00@juno.com)

Sent: Wednesday, August 11, 2004 5:36 AM

To:

Federal Communications Technology
Office of Engineering and Technology
Attn: Anh Wride

Room 7-A825 Portals II 445 12th Street SW Washington, DC 20024 Email: Awride@fcc.gov

Federal Communications Commission

Attn: Alan R. Stillwell

Room 7-C210 445 12th St SW Washington, DC 20024 Email: Astillwe@fcc.gov

Federal Communications Commission

Attn: Riley Hollingsworth 1270 Fairfield Road Gettsyburg, PA 17325 Email: Rholling@fcc.gov

Federal Communications Commission James R. Burtle Chief, Experimental Licensing Branch Room 7-A267 445 12th Street SW Washington, DC 20024 E-mail: jburtle@fcc.gov

Subject: Report of Harmful Interference

The following is a report of harmful interference I experienced while testing my mobile emergency communications station in the Cottonwood, Arizona area in preparation for Homeland Security and other emergency drills. As a member of the Federal Government sponsored Radio Amateur Civil Emergency Service, I see this as a very serious matter affecting the ability of the Amateur Service to fulfill its obligations as a public service and affecting communications vital to our Homeland Security.

I hereby request that you demand that the persons or organizations responsible for this interference cease operation of the cause of this interference as you are required to do under Part 15 of the Communications Act. It is understood that the operator should have a reasonable time to mitigate this interference but it is also understood that due to other complaints, they have had way more than a reasonable time to do this.

Name of complainant: James E.Clark

Call sign (if applicable): N5RO

Station location: Parking lot at intersection of State Route 89A and State Route 260, Cottonwood, Arizona.

Mailing address (if different):11250 E State Route 69, #1125

City, State, Zip: , Dewey, AZ 86327

Telephone: 928-775-8432 Email: jimc100@juno.com

Description of Interference: Strong BPL signal at (kHz): 3735 kHz - S-9+30db, 3838.5 -

S-9, 3860 - S-9+10db, 3909 - S-9+40db, 3914 - S-9+35db, 3919 - S-9+30db, 3928 -

S-9+30db, 3941 - S-9+25db, 3949 - S-9+20db, 3957 - S-9+20db, 3970 - S-9+S-9+20db, 3989 - S-9+10db, 28331.5 - S-5, 28.399 - S-6, 28464.6 - S-9+10db, 28476.8 - S-9+10db, 28890.5 - S-9

Description of station: Kenwood TS-120 solid state HF transeiver

Receiver(s) affected: Kenwood TS-120 solid state HF transeiver

Antenna type: Vertical mobile - "screwdriver" type tunable

Antenna location: Rear bumber of minivan

Distance of antenna from own house (feet): n/a

Distance of antenna from neighboring houses (feet): ~500 feet

Distance of antenna from power distribution line or equipment (feet): Approximately 4000 feet

Log of interference: at (kHz): 3735 kHz - S-9+30db, 3838.5 - S-9, 3860 -

S-9+10db, 3909-S-9+40db, 3914-S-9+35db, 3919-S-9+30 db, 3928-S-9+S-9+30db, 3949-S-9+20db, 3957-S-9+20db, 3970-S-9+20db, 3989-S-9+20db, 3989-S-9+20db

S-9+10db, 28331.5 - S-5, 28.399 - S-6, 28464.6 - S-9+10db, 28476.8 - S-9+S-9+10db, 28890.5 - S-9

Date: 8/10/2004

Time: 1030 - 1115 hours MST

Frequency: (kHz) 3735 to 3989 & 28300 to 28891 (see above)

Receive Mode: SSB

Interfering signal strength: S-5 to S-9+40db (see above)

Description: Characteristic BPL signal..

BOOTH, FRERET, IMLAY & TEPPER, P.C.

14356 CAPE MAY ROAD SILVER SPRING, MD 20904 TELEPHONE 301.384.5525 FACSIMILE 301.384.6384 BFTTPC@AOL.COM

October 11, 2004

Via Courier and E-mail James.Burtle@fcc.gov David.Solomon@fcc.gov Bruce.Franca@fcc.gov

James R. Burtle, Chief
Experimental Licensing Division
Office of Engineering and Technology
Federal Communications Commission
445 Twelfth Street, S.W.
Washington, D.C. 20554

David Solomon, Chief Enforcement Bureau Federal Communications Commission 445 Twelfth Street, S.W. Washington, D.C. 20554

Bruce Franca, Deputy Chief Office of Engineering and Technology Federal Communications Commission 445 Twelfth Street, S.W. Washington, D.C. 20554

Re: Experimental Station WB9XVP (File No. 0136-EX-ST-2004)
At Cottonwood (Yavapai County) Arizona; Broadband Over Power
Line System; Evaluation and Critique of 6-Month STA Report.

Gentlemen:

This letter is in response to the Experimental Special Temporary Authorization Six-Month Progress Report filed by Electric Broadband (EB) dated September 16, 2004 with respect to the above-referenced EB broadband over power line (BPL) system operated pursuant to Special Temporary Authority. As background, ARRL, the National Association for Amateur Radio (ARRL) had complained on August 17, 2004 by letter, with exhibits, of both actual harmful interference to Amateur Radio operation from this test system, and, based on measurements of the system in situ, of radiated emissions far above the levels permitted by Part 15 regulations. No action has apparently been taken by the Commission on that complaint, but EB responded on September 3, 2004 by letter,

which was served on counsel for ARRL. ARRL replied to that EB letter on September 16, 2004. This 6-month report followed. The referenced STA has now expired, but the system apparently continues to operate nevertheless.

Attached hereto is a technical analysis of the EB six-month report. To be blunt, as can be easily determined from the EB report itself, one of two things occurred: either (1) EB altered the data to suit its false conclusion that the system is operating in accordance with FCC rules; or (2) its technical consultants were not qualified to conduct the tests, and glaringly misinterpreted, among other things, the source of noise generated internally in their own test equipment.

At page 3 of the EB report, EB notes that it conducted equipment tests in April of 2004 before starting operation, and asserts that the system was allegedly in compliance at that time, but it admits that the antenna it used at the time was in unknown condition and had failed testing later, so in fact, it had no idea of the status of the system when it commenced operation. Furthermore, it admits at page 4 of the Report that when the system was rebooted, it was likely operating well above Part 15 limits.

The report indicates on the face of it that in the low-band VHF public safety allocation at 30-50 MHz, the BPL system is operating at radiated emission levels significantly in excess of permitted Part 15 levels.

Most urgently, however, the test results are inconsistent, demonstrating that the ambient noise conditions at the test sites were clearly misstated. The EB test results are completely compromised and cannot be utilized in order to determine whether or not the system is operating in accordance with FCC Part 15 rules.

ARRL has previously established that the system is operating substantially in violation of Part 15 rules and is causing actual interference. The Commission has done absolutely nothing to either enforce its rules or protect licensed radio services from interference. ARRL insists again that this system be shut down immediately and that it not be permitted to commence operation again absent a satisfactory showing that it can operate without interference to licensed radio services. The present STA, which expired September 16, 2004, cannot be reinstated or extended, and no experimental authorization should be permitted for this system.

ARRL respectfully requests that the Commission respond to this correspondence and indicate what action it is taking to preclude further instances of interference from this test system.

Yours very truly,

Christopher D. Imlay Christopher D. Imlay

Cc: Lance Rosen, Electric Broadband, LLC